


Model 212  
(Countries with high dust levels)

- Service A
- Service B
- Plus package
- For every service (equipment specific)
- Once at 3,000 km (1,850 mi)
- Service 3 at every service
- Service 4 every 2 years
- Service 8 every 50,000 km (31,000 mi) / 3 years
- Service 8 every 75,000 km (46,500 miles)/4 years
- Service 10 every 50,000 km (31,000 miles)/3 years
- Service 11 every 75,000 km (46,500 mi) / 4 years
- Service 11 every 250,000 km (155,000 miles)/15 years
- Service 12 every 50,000 km (31,000 miles) / 3 years
- Service 12 every 75,000 km (46,500 miles) / 4 years
- Service 13 every 250,000 km (155,000 mi) / 15 years
- Service 15 at every Service B
- Service 20 once at 50,000 km (31,000 mi) / 3 years
- Service 20 every 100,000 km (62,000 mi) / 5 years
- Service 20 every 125,000 km (77,500 miles)/5 years

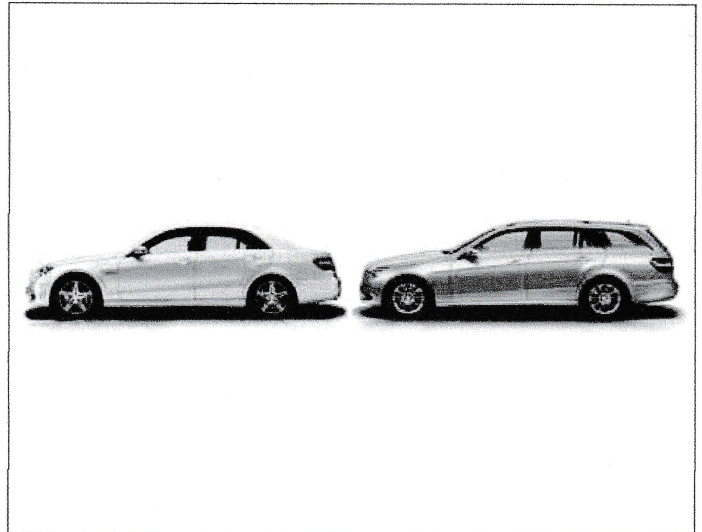

P00.00-4883-11

Customer Carsten Bøgh Poulsen Order number \_\_\_\_\_

VIN/license plate number WDD2120881A895039/BX39247 Current mileage 114.317 km

Service code \_\_\_\_\_ Workshop code \_\_\_\_\_

Remaining distance \_\_\_\_\_ Remaining time 25 days

Oil type/viscosity 0W-30 Completion time/date 2021-11-17

Service consultation performed at vehicle Yes No

Notes/explanations \_\_\_\_\_

The following activities are hereby confirmed:  
- Completion of relevant service operations

Signature Carsten Bøgh Poulsen

A Completed <input checked="" type="checkbox"/>	B <input checked="" type="checkbox"/>		Input condition not OK: <input checked="" type="checkbox"/>	
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<b>Service reception</b> The completely edited reception report for service on vehicle is available ..... <b>i</b> To be performed by the Service Advisor (where market-specific conditions require). The service scope is only fully performed when all acceptance items and the maintenance items listed in the service sheet have been processed.	<input type="checkbox"/>	AP00.20-P-0009Z
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<b>Brake system</b> Perform brake test and enter the result in the table .....	<input type="checkbox"/>	AP42.00-P-4290BA
	<input type="checkbox"/>	<b>Vehicle exterior</b> Check exterior lights for proper operation ..... Check operation of headlamp range adjustment ..... Vehicles with xenon or dynamic LED headlamps or headlamp range controller on the exterior lights switch ..... Check and correct the adjustment of the headlamps ..... <b>i</b> On vehicles equipped with level control or Xenon or dynamic LED headlamps, adjustment of the headlamps is to be invoiced as an additional operation.	<input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/> <input type="checkbox"/>	AP82.10-P-8252EW AP82.10-P-8250EW AP82.10-P-8260EW
	<input type="checkbox"/>	<b>Vehicle interior</b> Check windshield wipers, windshield washer system and headlamp cleaning system for proper operation .....	<input type="checkbox"/>	AP82.30-P-8252EW
<input type="checkbox"/>	<input type="checkbox"/>	Replace activated charcoal dust filter .....		AP83.00-P-8384EW
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<b>Engine compartment</b> Clean water drain ..... Brake system: Check fluid level .....	<input type="checkbox"/> <input type="checkbox"/>	AP82.35-P-8232A AP42.10-P-4210EW
	<input type="checkbox"/> <input checked="" type="checkbox"/>	Check all visible parts in engine compartment for damage and leaks ..... Check visible area of poly-V belt for wear .....	<input type="checkbox"/> <input type="checkbox"/>	AP00.20-P-0055EW AP13.22-P-1352EW
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<b>Underside of vehicle</b> Check all visible parts of vehicle underside for damage and leakage ..... Check track rod and drag link linkage for play, check boots ..... <b>i</b> The country-specific regulations for mobility and body shell complaints apply.	<input type="checkbox"/> <input type="checkbox"/>	AP00.20-P-0054EW AP46.00-P-4653EW

<input type="checkbox"/>	<input type="checkbox"/>	Check front axle ball joint for play, check boots	.....	<input type="radio"/>	AP33.20-P-3353EW
<input type="checkbox"/>	<input type="checkbox"/>	Check condition of drive shaft and flexible couplings	.....	<input type="radio"/>	AP41.10-P-4152EW
<input type="checkbox"/>	<input type="checkbox"/>	Check tires for damage and cracking and enter result in table	.....	<input type="radio"/>	AP40.10-P-4051EW
<b>Tires</b>					
<b>Plus package</b>					
<input checked="" type="checkbox"/>	<input type="checkbox"/>	Correct tire pressure and enter set tire pressure in the table	.....	<input type="radio"/>	AP40.15-P-4061A

<input checked="" type="checkbox"/>	<input type="checkbox"/>	Check TIREFIT tire sealant	.....	<input type="radio"/>	AP40.10-P-4054R
Vehicles fitted with TIREFIT					
<b>i</b> Enter TIREFIT expiration date here:					
.....					
<b>i</b> Replace TIREFIT, invoice as additional operation.					
<input checked="" type="checkbox"/>	<input type="checkbox"/>	Check first aid kit	.....	<input type="radio"/>	AP68.00-P-6850EW
<b>i</b> Enter first aid kit expiration date here:					
.....					
<b>i</b> Replace first-aid kit, invoice as an additional operation.					
<input checked="" type="checkbox"/>	<input type="checkbox"/>	Check luggage compartment illumination for proper operation	.....	<input type="radio"/>	
<b>Engine compartment</b>					
<b>Plus package</b>					
<input checked="" type="checkbox"/>	<input type="checkbox"/>	Windshield washer system: Check/correct fluid level	.....	<input type="radio"/>	AP82.35-P-8210EW
<b>i</b> Use summer/winter cleaner as well as the mixing ratio to match the ambient temperature.					
<b>Vehicle interior</b>					
<b>Plus package</b>					
<input checked="" type="checkbox"/>	<input type="checkbox"/>	Check lamps in the instrument cluster and interior illumination for proper operation	.....	<input type="radio"/>	AP54.30-P-5453EW

<input checked="" type="checkbox"/>	<input type="checkbox"/>	<p><b>Engine compartment</b>  <b>Service 3 at every service</b>            Engine: Change oil and filter</p> <p style="text-align: right;">ow-30</p> <p>-----</p> <p style="text-align: right;">Engine 276</p> <p style="text-align: right;">AP18.00-P-0101CWZ</p>
<input type="checkbox"/>	<input type="checkbox"/>	<p><b>Engine compartment</b>  <b>Service 4 every 2 years</b>            Brake system: Replace brake fluid</p> <p>-----</p> <p style="text-align: right;">AP42.00-P-4280EW</p>

<input checked="" type="checkbox"/>	<input type="checkbox"/>	<p><b>Engine compartment</b>  <b>Service 8 every 75,000 km (46,500 miles)/4 years</b>            Replace air filter element</p> <p>-----</p> <p style="text-align: right;">Engine 276.9</p> <p style="text-align: right;">AP09.10-P-0980MM</p>
-------------------------------------	--------------------------	--

<input checked="" type="checkbox"/>	<input type="checkbox"/>	<p><b>Vehicle interior</b>  <b>Service 11 every 250,000 km (155,000 miles)/15 years</b>            Replace fuel filter</p> <p>-----</p> <p style="text-align: right;">Engine 156, 157, 271, 272, 273,            274, 276, 278</p> <p style="text-align: right;">AP47.20-P-0780EW</p>
-------------------------------------	--------------------------	---

<input checked="" type="checkbox"/>	<input type="checkbox"/>	<b>Engine compartment</b> Service 12 every 75,000 km (46,500 miles) / 4 years Replace spark plugs	..... Engine 157, 272, 273, 276, 278	AP15.10-P-1580EW
<input checked="" type="checkbox"/>	<input type="checkbox"/>	<b>Underside of vehicle</b> Service 13 every 250,000 km (155,000 mi) / 15 years Replace main circuit coolant	.....	AP20.00-P-2080EW

<input checked="" type="checkbox"/>	<input type="checkbox"/>	<b>Underside of vehicle</b> Service 20 once at 50,000 km (31,000 mi) / 3 years Automatic transmission: Carry out oil and filter change	..... Transmission 722.9## #2 up to 834526 except 722.930/931/971	AP27.00-P-2702W
-------------------------------------	--------------------------	--	--	-----------------

<input checked="" type="checkbox"/>	<input type="checkbox"/>	<b>Underside of vehicle</b> Service 20 every 125,000 km (77,500 miles)/5 years Automatic transmission: Carry out oil and filter change	..... Transmission 722.9## #2 as of 834527 except 722.930/931/971	AP27.00-P-2702W
-------------------------------------	--------------------------	--	--	-----------------

**Brake values**

	Left	Right
Front		
Rear	OK	OK
Parking brake		

**Tire condition**

	Right front	Left front	Right rear	Left rear
Condition OK.	✓	✓	✓	✓
Condition NOK.				

**Set tire pressure in bar or psi**

	Front axle	Rear axle	Spare wheel
bar/psi	2.40	2.40	✓